



Nail Drill User Manual

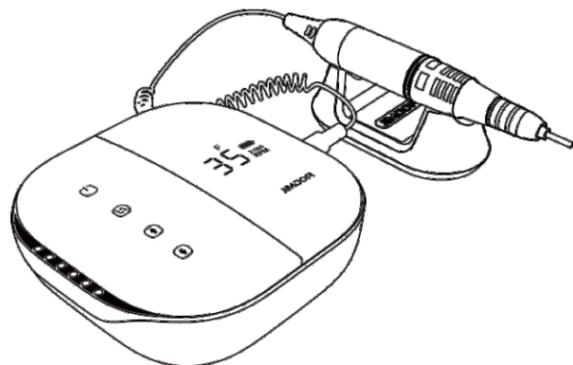


JMD-E108

JIMDOA makes you more attractive

NAIL DRILL SYSTEM

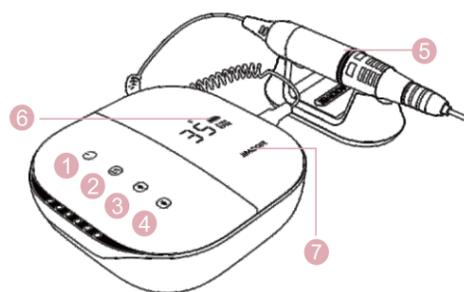

- | | |
|----------------------------|-------------------|
| 1 Tap the switch to unlock | 6 Battery display |
| 2 Forward/Reverse | 7 OEM your logo |
| 3 Increase speed | 8 Nail drill bits |
| 4 Decrease speed | 9 Power adapter |
| 5 Handpiece | 10 Base |

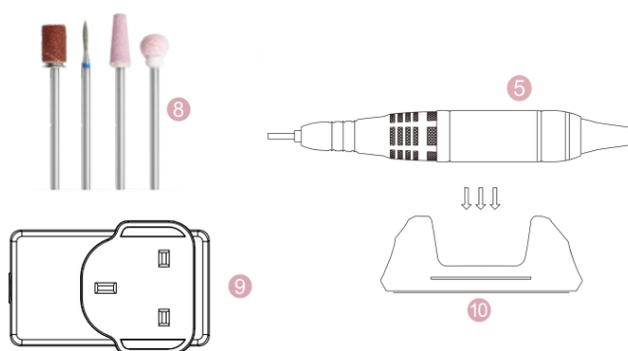


- 1 -

PRECAUTION

1. Do NOT disassemble the handpiece
2. Do NOT drop the handpiece
3. Do not work in a humid environment.
4. Operating Environment Humidity: 30-75%
5. Operating Environment Temperature: +10°C ~ +40°C
6. Turn off the power when changing the bits
7. Make sure the power switch is off before plugging in the power cord to avoid an unexpected injury due to sudden start.


SPECIFICATION

1. Input : AC100-240v 50/60HZ
2. Output: 3-18V
3. Power: 36W
4. Speed: 35000RPM

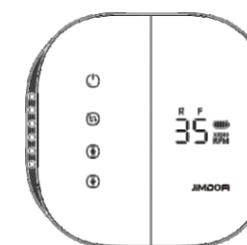

- 2 -

1. Set drill bits

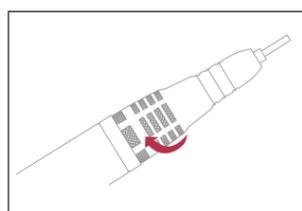


1

Turn left side clockwise until you hear it click into the place


2

Take out the original bit

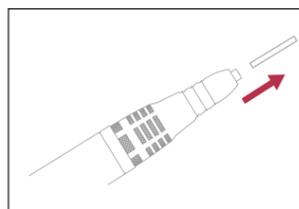


3

Insert the 3/32" size bit

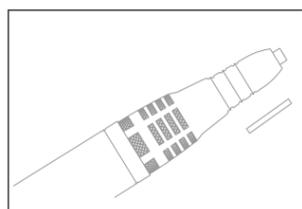

4

Turn right side anti-clockwise to lock the bit tightly

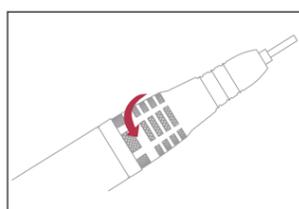


- 3 -

2. Operation Steps:

- 1: When you touch the on-off key "⏻" for 2 seconds, the function keys light up from top to bottom, and the machine enters the working state.
- 2: When touching the forward and reverse "⏪ ⏩" keys, the machine will enter the working state. R stands for reverse rotation and F stands for forward rotation. Touch again to realize R / F conversion.
- 3: When touching the "⏴" key, it is the upshift key 0-35 (RPM*1000), long press can continuously jump to 35 (RPM*1000), or adjust to the desired setting gear.
- 4: When the "⏵" key is touched, it is the downshift key 35-0 (RPM*1000), long press can continuously jump to 0 (RPM*1000), or adjust to the desired setting gear.
- 5: Press the power button again, the machine stops working at this time, and the alternate light flashes to indicate that it is in standby mode.
- 6: When the battery display "🔋" turns Red: It represents that the battery capacity is less than 10%, you need to connect the power adapter to charge the machine.
- 7: When the battery display "🔋" reaches 99, it means that the battery is already fully charged, please unplug the power adapter.

- 4 -

3. Innovative experience

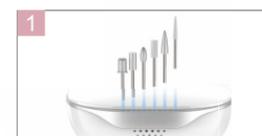

grinding head magnetic absorption storage beautiful appearance easy to use create a new experience.



Use more advanced in film injection process (IMD)



Match with various drill bits more convenient for manicure



The bottom plate is made of stainless steel, and the drawing technology is more stable and exquisite.



the maximum speed can reach 35000rpm

the maximum speed can reach 35000rpm

